Shopmate Series

MIG/Multiprocess Welding Power Sources





Quick Specs

Light Industrial Applications

Recreational Vehicle Trailer Manufacturing MRO — Maintenance/Repair Education Farm/Home

Shopmate 300 Processes

MIG (GMAW) Flux Cored (FCAW)

Shopmate 300 DX Processes

MIG (GMAW) Flux Cored (FCAW) Stick (SMAW) DC Lift-Arc™ TIG (GTAW) **Input Power** 1-Phase Power

(primary power cord not included)

Rated Output 250 A at 30 VDC, 60% Duty Cycle

300 A at 32 VDC, 40% Duty Cycle

Amperage Range in CC Mode 5-400 A Max. Open-Circuit Voltage 80 VDC Voltage Range in CV Mode 10-35 VDC

Weight 300: 177 lb (80.3 kg) **300 DX:** 177 lb (80.3 kg)

The Power of Blue®

Shopmate 300

Single-phase MIG power source that provides versatility and outstanding arc performance in CV mode (MIG).

Shopmate 300 DX

Single-phase MIG or DC multiprocess capability for versatility with outstanding arc performance in CV mode (MIG) and CC mode (Stick and TIG).

Large, dual digital meters enable the operator to preset weld voltage in CV mode and amperage in the CC mode (DX model only) before striking an arc.

Arc control adjusts inductance to optimize MIG arc performance.

Line voltage compensation keeps output power constant even if input power varies ±10%.



Shopmate 300 DX MIG Packages (see page 4)



Built-in 10-pin connector for direct hookup of Spoolmatic® 15A or 30A spool guns.

Built-in 14-pin connector provides quick, direct connection for 14-pin 24 VAC Miller wire feeders and accessories.

Fan-On-Demand™ operates only when needed reducing noise, power consumption, and the amount of airborne contaminants pulled through the machine.


Shopmate 300 DX includes:

Process Selector Switch "operator-friendly" single process switch eliminates confusion caused by several switch combinations.

Lift-Arc TIG™ allows DC/TIG starting without the use of high-frequency. Starts the arc without contaminating the weld with tungsten.



Power source is warranted for 3 years, parts and labor. Original main power rectified parts are warranted for 5 years.





Miller Electric Mfg. Co.

An Illinois Tool Works Company 1635 West Spencer Street Appleton, WI 54914 USA

International Headquarters

Phone: 920-735-4505 USA FAX: 920-735-4134 Canadian FAX: 920-735-4169 International FAX: 920-735-4125

Web Site

www.MillerWelds.com



Shopmate™ 300 Specifications (Subject to change without notice.)








Rated Output	Amperage Range	Voltage Range	Max. Open- Circuit Voltage	Amps I 208 V	nput at R 230 V	ated Outpu 460 V	ıt, 60 Hz 575 V	KVA	KW	Dimensions	Net Weight
250 A at 30 VDC, 60% Duty Cycle	5-400 A	10-35 V	80 VDC	66	57	29	23	13	11.2	H: 24-1/2 in (622 mm) including lift eye W: 19 in (483 mm) D: 25-1/2 in (648 mm)	177 lb (80.3 kg)

Note: For input conductor and fuse size information consult the Owner's Manual.




Certified to both the Canadian and U.S. Standards for welding equipment.

Performance Data

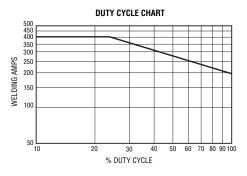

Control Panel

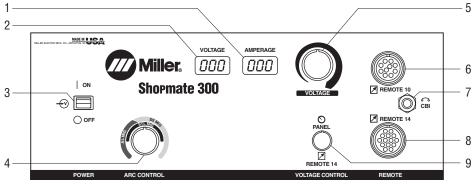

- 1. Ammeter
- 2. Voltmeter
- 3. Power Switch
- 4. Arc Control
- 5. Voltage Adjustment Control
- 6. Remote 10 Receptacle
- 7. Supplementary Protector CBI
- 8. Remote 14 Receptacle
- 9. Voltage Control Switch

Arc Control



Example: Preset for MIG welding with steel wire

Control adjusts inductance for MIG welding. Set Arc Control to desired wire type. Inductance determines the "wetness" of the weld puddle. As setting is increased (rotating Arc Control clockwise), wetness (puddle fluidity) increases. For best results, preset Arc Control to the wire type. Then either increase or decrease setting within wire type scale to make fine adjustment to the welding arc.



Arc Control (Counter Clockwise) Low Inductance Weld Bead

Arc Control (Clockwise) High Inductance Weld Bead



Shopmate™ 300 DX Specifications (Subject to change without notice.)








Rated Output	Amperage Range	Voltage Range	Max. Open- Circuit Voltage	Amps I 208 V	nput at R 230 V	ated Outpu 460 V	t, 60 Hz 575 V	KVA	KW	Dimensions	Net Weight
250 A at 30 VDC, 60% Duty Cycle	5-400 A	10-35 V	80 VDC	66	57	29	23	13	11.2	H: 24-1/2 in (622 mm) including lift eye W: 19 in (483 mm) D: 25-1/2 in (648 mm)	177 lb (80.3 kg)

Note: For input conductor and fuse size information consult the Owner's Manual.

Certified to both the Canadian and U.S. Standards for welding equipment.

Performance Data

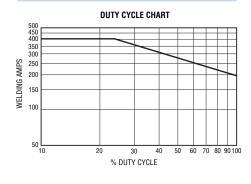


Control Panel



- 1. Ammeter
- 2. Voltmeter
- 3. Power Switch
- 4. Arc Control
- 5. Voltage/Amperage Adjustment Control
- 6. Remote 10 Receptacle
- 7. Supplementary Protector CBI
- 8. Remote 14 Receptacle
- 9. Voltage/Amperage Control Switch Control allows selection of either panel or remote 14 for amperage or voltage control.
- 10. Mode Switch Switch determines both the process and output On/Off control. Electrode hot areas in gray are "contactor on" positions.

Arc Control — Inductance/MIG





Example: Preset for MIG process and steel wire

Control adjusts inductance for MIG welding. Set Arc Control to desired wire type. Inductance determines the "wetness" of the weld puddle. As setting is increased (rotating Arc Control clockwise), wetness (puddle fluidity) increases. For best results, preset Arc Control to the wire type. Then either increase or decrease setting within wire type scale to make fine adjustment to the welding arc.




Arc Control (Counter Clockwise) Low Inductance Weld Bead



Arc Control - DIG/Stick





Example: Stick Mode, 7018 Electrode

Control adjusts Dig when Stick mode is selected on mode switch. Set Arc Control to desired electrode type. For best results, preset Arc Control in middle of the scale for appropriate electrode type. Then either increase or decrease setting within electrode type scale to make fine adjustment to the welding arc.



Shopmate™ 300 MIG Package Components

Shopmate 300 MIG Package

#951 056 200(208)/230 V **#951 058** 230/460/575 V

Comes Complete With:

- Shopmate 300
- 22A wire feeder with Bernard® Q300 15 ft (4.6 m) gun
- MIG Kit #300 150 including:
 - 15 ft (4.6 m) 1/0 work cable with clamp
 - 10 ft (3 m) 1/0 interconnecting cable
 - Ar/CO₂ regulator with flowtube
 - 10 ft (3 m) gas hose
 - Consumable storage box

Note: MIG Kit can be ordered separately.



Shopmate™ 300 Spool Gun Package Components

Shopmate 300 Spool Gun Package

#951 057 200(208)/230 V **#951 059** 230/460/575 V

Comes Complete With:

- Shopmate 300
- Spoolmatic® 30A spool gun
- Spool Gun Kit #300 151 including:
- 15 ft (4.6 m) 1/0 work cable with clamp
- Ar/CO₂ regulator with flowtube
- · Consumable storage box

Note: Spool Gun Kit can be ordered separately.



Shopmate™ 300 DX MIG Package Components

Shopmate 300 DX MIG Package

#951 076 200(208)/230 V **#951 077** 230/460/575 V

Comes Complete With:

- Shopmate 300 DX
- 22A wire feeder with Bernard® Q300 15 ft (4.6 m) gun
- MIG Kit #300 150 including:
 - 15 ft (4.6 m) 1/0 work cable with clamp
 - 10 ft (3 m) 1/0 interconnecting cable
 - Ar/CO₂ regulator with flowtube
 - 10 ft (3 m) gas hose
 - Consumable storage box

Note: MIG Kit can be ordered separately.





Upgrade Benefits

Features	Millermatic® 2	52	Shopmate 300		Shopmate 300	DX	Millermatic® 350		Millermatic® 350P	
Input Voltage	1-Phase		1-Phase		1-Phase	Upgrade	1-Phase/3-Phase		1-Phase/3-Phase	
Input Amperage at Rated Output	42 A, 230 VAC (1-Phase)		57 A, 230 VAC (1-Phase)		57 A, 230 VAC (1-Phase)		61 A, 230 VAC (1-Phase)		61 A, 230 VAC (1-Phase)	
Rated Output	200 A at 60%	Upgrade	250 A at 60%		250 A at 60%	Upgrade	300 A at 60%		300 A at 60%	
Process	MIG		MIG	Upgrade	MIG, DC Stick, DC TIG		MIG	Upgrade	MIG, Pulsed MIG	
Arc Control	Active Arc Stabilizer	Upgrade	MIG — variable inductance	Upgrade	MIG — variable inductance Stick — variable DIG		MIG — inductance control		MIG — inductance control Pulsed — SharpArc® (arc width)	
Wirefeed System	All in one, 2 drive rolls	Upgrade	14-pin remote Miller wire feede	r	14-pin remote Miller wire feeder		All in one, angled 4 drive rolls		All in one, angled 4 drive rolls	

Genuine Miller Accessories

Wire Feeders



22A #193 066 24A #195 112

Simple, reliable, 24 VAC constant-speed semiautomatic wire feeder, best suited for small diameter wires. Accommodates up to 60 lb (27.2 kg) spool of welding wire when using optional wire reel assembly. 24A includes remote voltage and four gear-driven drive rolls for larger wire sizes. 22A and 24A wire feeders come with FREE Bernard® Q™-Gun! See Lit, Index No. M/11.0.



Single Wire Models S-74S #195 057

S-74D #195 058

S-74DX #195 059

Dual Wire Models D-74S #195 060

D-740 #195 061

D-74DX #195 062

Heavy-duty, industrial, constant-speed 24 VAC semiautomatic wire feeders in single and dual models, with available digital meters. Ideal for high-duty-cycle MIG welding (GMAW) and Flux Cored welding (FCAW). Accommodates a wide variety of wire sizes and types. Comes with FREE Bernard[®] Q™-Gun! Dual wire feeder models include two FREE Q-Guns. See Lit. Index No. M/3.0.





Shopmate™ 300 MIG Kit #300 150 Includes 15 ft (4.6 m) 1/0 work cable with clamp, 10 ft (3 m) 1/0 interconnecting cable, Ar/CO₂ regulator with flowtube, 10 ft (3 m) gas hose and consumable storage box.



Spoolmatic® 15A Spool Gun #195 156 Spoolmatic® 30A Spool Gun #130 831 Ideal for aluminum welding jobs. 200 amp, 100% duty cycle, air-cooled, 1 lb spool gun with your choice of 15 ft (4.6 m) or 30 ft (9.1 m) cable assembly. For detailed information, see Spoolmatic literature, Index No. M/1.5.



Shopmate^m 300 Spool Gun Kit #300 151 Includes 15 ft (4.6 m) 1/0 work cable with clamp, Ar/CO₂ regulator with flowtube, and consumable storage box.



Genuine Miller Accessories (Continued)

Remote Controls and Switches



RMLS-14 #129 337

Momentary- and maintained-contact rocker switch for contactor control. Push forward for maintained contact and back for momentary contact. Includes 20 ft (6 m) cord and 14-pin plug.



RCC-14 Remote Contactor and Current Control #151 086

Rotary-motion (side to side) fingertip control. Fastens to TIG torch using two Velcro strips. Allows complete current and contactor control at operator's fingertips. Includes 28 ft (8.5 m) cord and plug.



RCCS-14 Remote Contactor and Current Control #043 688

Up-and-down rotary-motion fingertip control. Great for applications that require a finer amperage control. Includes 28 ft (8.5 m) control cord.



RHC-14 Hand Control #129 340 20 ft (6 m) cord Miniature hand control with 14-pin plug for remote current and contactor control. Dimensions: 4 x 4 x 3-1/4 in (102 x 102 x 82 mm).



RFCS-14 Foot Control #043 554 Heavy-duty foot current and contactor control. Includes 20 ft (6 m) cord and 14-pin plug.

Extension Cables for 14-Pin Plugs to 14-Pin Sockets

#122 973 25 ft (7.6 m) **#122 974** 50 ft (15.2 m) **#122 975** 75 ft (22.8 m)

This extension cord makes a direct connection between the power source and the accessory control or wire feeder. No messy splicing or adapting required.



No. 2 Stick Cable Set #195 196 15 ft (4.6 m)

Consists of 15 ft (4.6 m) No. 2 electrode cable and holder, and 15 ft (4.6 m) work cable and clamp. 200 A, 100% duty cycle.

No. 2 Stick Cable Set #195 195 50 ft (15.2 m)

Consists of 50 ft (15.2 m) No. 2 electrode cable and holder, and 50 ft (15.2 m) work cable and clamp. 200 A, 100% duty cycle.



Shopmate™ 300 Running Gear/ Dual Cylinder Rack #300 145

The large 10 in (254 mm) rear wheels and 4 in (102 mm) front casters on this running gear provide excellent mobility on the shop floor, making it easier to move the power source around and over cables and cracks. Very easy to install. Handles double as weld cable holder. Holds two cylinders.

TIG (GTAW) Torches



Weldcraft® TIG Torches

The Weldcraft line of TIG torches complements the most popular TIG power source line available today. The Weldcraft torch line includes both air-cooled and water-cooled models. Available with genuine Weldcraft parts.

Air-Cooled Torch #WTP17VRM

150 amp air-cooled TIG torch with valve, flowmeter and 25 ft (7.6 m) cables.

Air-Cooled Torch #WTP26VRM

200 amp air-cooled TIG torch with valve, flowmeter and 25 ft (7.6 m) cables.

TIG (Gas Tungsten Arc Welding) Handbook #170 555

To order, call the Miller Literature Distribution Center at 1-920-751-2120, or FAX 1-920-751-2121. A comprehensive, text on all aspects of the TIG process.



Notes



Ordering Information

Equipment and Options	Stock No.	Description	Qty.	Price
Power Source				
Shopmate™ 300	#907 313	200(208)/230 V, 60 Hz		
(primary power cord not included)	#907 314	230/460/575 V, 60 Hz		
Shopmate™ 300 MIG Package	#951 056	200(208)/230 V, 60 Hz model with 22A wire feeder, Bernard® Gun and MIG Kit.		
(primary power cord not included)	#951 058	230/460/575 V, 60 Hz model with 22A wire feeder, Bernard® Gun and MIG Kit.		
Shopmate™ 300 Spool Gun Package	#951 057	200(208)/230 V, 60 Hz model with Spoolmatic® 30A spool gun and Spool Gun Kit.		
(primary power cord not included)	#951 059	230/460/575 V, 60 Hz model with Spoolmatic® 30A spool gun and Spool Gun Kit.		
Shopmate™ 300 DX	#907 315	200(208)/230 V, 60 Hz		
(primary power cord not included)	#907 316	230/460/575 V, 60 Hz		
Shopmate™ 300 DX MIG Package	#951 076	200/230 V, 60 Hz model with 22A wire feeder, Bernard® Gun and MIG Kit.		
(primary power cord not included)	#951 077	230/460/575 V, 60 Hz model with 22A wire feeder, Bernard® Gun and MIG Kit.		
Accessories				
Shopmate™ 300 MIG Kit	#300 150	15 ft (4.6 m) 1/0 work cable with clamp, 10 ft (3 m) 1/0 interconnecting cable, regulator with flowtube, 10 ft (3 m) gas hose and consumable storage box		
Shopmate™ 300 Spool Gun Kit	#300 151	15 ft (4.6 m) 1/0 work cable with clamp, regulator with flowtube, and consumable storage box		
Standard Running Gear/ Dual Cylinder Rack	#300 145			
Wire Feeders/Guns				
22A	#193 066	See Lit. Index No. M/11.0		
24A	#195 112	See Lit. Index No. M/11.0		
70 Series		See page 5		
XR™-Control	#181 538	See Lit. Index No. M/1.7		
Spoolmatic [®] 15A	#195 156			
Spoolmatic® 30A	#130 831			
Remote Controls				
RMLS-14	#129 337	Rocker switch		
RCC-14	#151 086	Fingertip control (side to side)		
RCCS-14	#043 688	Fingertip control (up and down)		
RHC-14	#129 340	Hand control w/20 ft (6 m) cord and 14-pin plug		
RFCS-14	#043 554	Foot control		
Extension Cables		See page 6		
No. 2 Stick Cable Set	#195 196	15 ft (4.6 m)		
No. 2 Stick Cable Set	#195 195	50 ft (15.2 m)		
TIG Welding				
Weldcraft® TIG Torches	#WTP17VRM	150 A, 25 ft (7.6 m) air-cooled with valve and flowmeter		
	#WTP26VRM	200 A, 25 ft (7.6 m) air-cooled with valve and flowmeter		
Educational Resources		` '		
TIG (Gas Tungsten Arc Welding) Handbook	#170 555			

Date: Total Quoted Price:



Distributed by: